Evolution3 BenchTop User Guide – Care and maintenance

KEENCUT

Contents

1. Care and maintenance 2

1.1 Clean your machine 2


1.2 Maintain the bearing track 3

1.3 Change the sightline strip 4


1. Care and maintenance

1.1 Clean your machine

See how to clean and maintain your machine in this video >

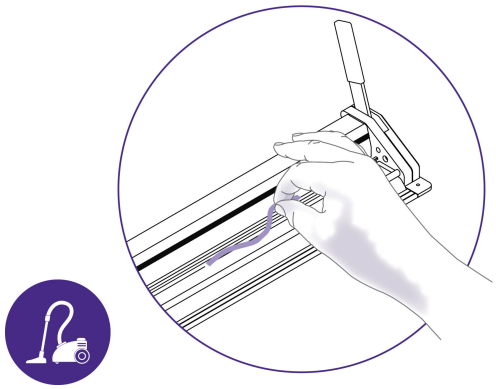


Use a vacuum cleaner to remove any dust and smaller debris.
Frequency: daily as required

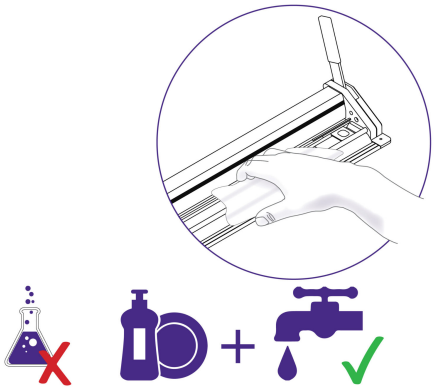

Moisten a cloth with diluted detergent to wipe down the cutter bar and base plate, dry with a cloth.
Frequency: weekly
DO NOT use solvents or aggressive cleaning products.

1.2 Maintain the bearing track


See how to maintain the bearing track in this video >

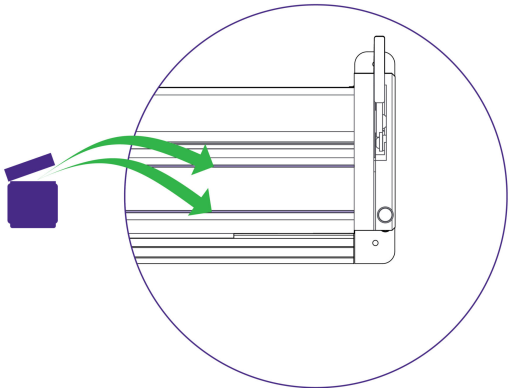


Put a small amount of petroleum jelly (Vaseline) on the scouring surface of a dish washing sponge and rub it up and down the two tracks. Wipe clean any surplus with a dry cloth.
Frequency:
Light use – monthly
Heavy use – weekly

1.3 Change the sightline strip


IMPORTANT: Ensure that you have a replacement sightline strip before proceeding

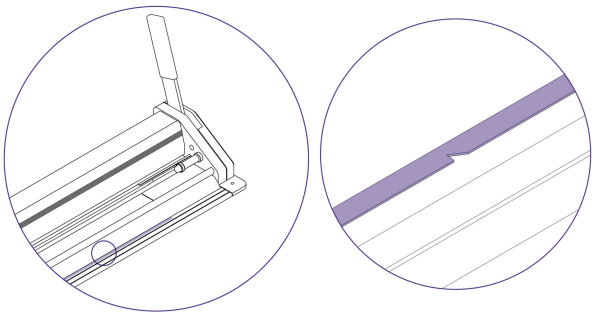

When using your BenchTop, the sightline strip may become scored or damaged.

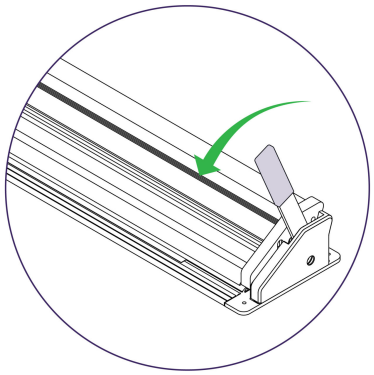


Use the handle to raise the cutter bar.

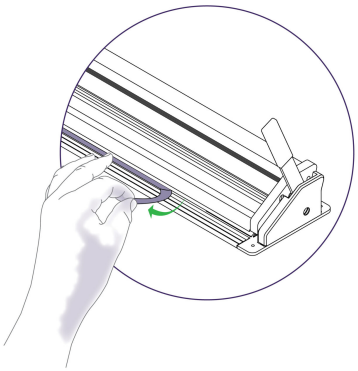


Remove the damaged sightline strip making sure that all residue from the adhesive tape is removed.




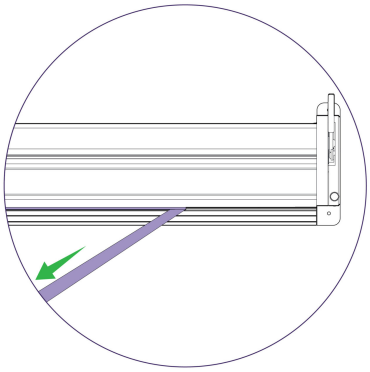

TIP: Pulling the loose end of the sightline strip slowly and gently at a 45° angle will reduce the amount of adhesive residue.
NOTE: If you are struggling to remove any adhesive residue, lightly use methylated spirit on a paper towel or cloth.

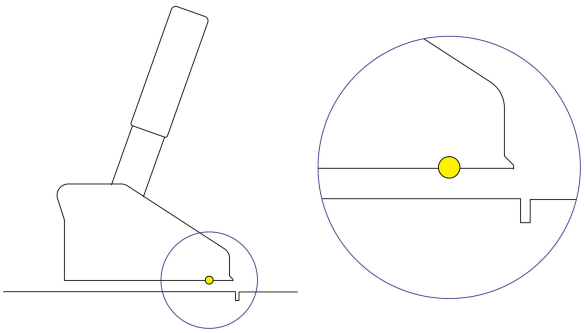


There is a yellow silicone grip strip fixed to the underside of the cutter bar, use this to help align the back edge of the replacement sightline strip.

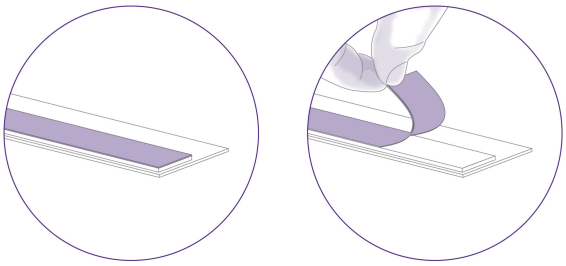


Remove the first 20cm – 8″ of the protective backing from the new sightline strip.




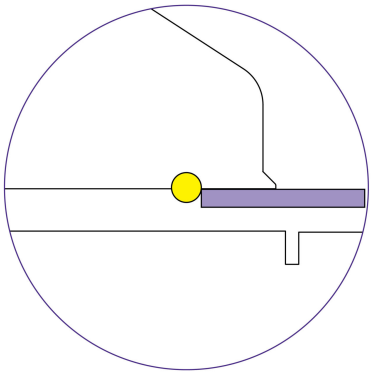

Apply the sightline strip in stages from one end of the cutter bar to the other using the yellow silicone chord as your guide; the back edge of the sightline strip should be touching the front edge of the silicone chord.
TIP: Remove the protective backing from the double sided tape in stages to prevent complications during application.

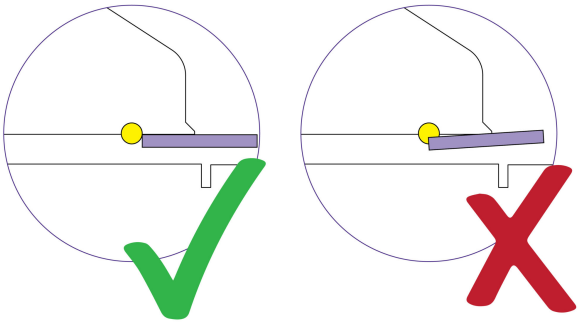


Ensure that the sightline strip does not overlap the silicone chord as this will affect the clamping of the cutter bar.

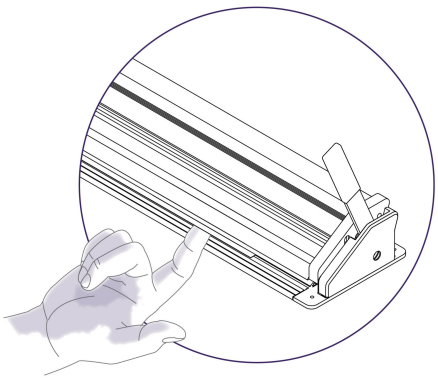

Use your finger to apply pressure to the underside of the sightline strip to ensure the sightline strip is secured in position.

IMPORTANT: When trimming the sightline strip it must be done on a piece of scrap material or cutting mat as the sightline strip can deflect into the groove.



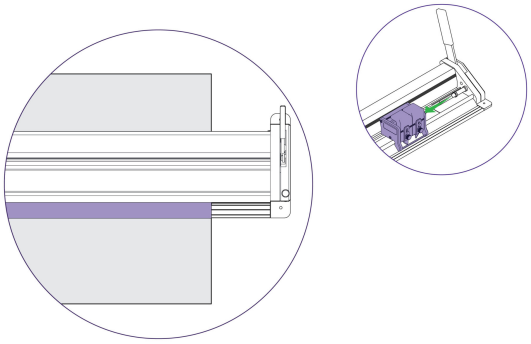

The sightline strip is wider than it needs to be and requires trimming to suit cutting line of the machine.
Use the Double Graphik tool head to gently cut through the sightline strip in 3 to 4 passes. This will ensure the sightline strip is not distorted and indicates the blades line of cut accurately.
TIP: Order replacement strips (or check stock) whenever you change the strip to save running out.